

HDP120 / HDP230 / HDP301 SOFTWARE RELEASE HISTORY

General

Minimum recommended software version: 1.6

Software update methods:

- **Local update:** CATVisor Commander 2.9 or later, 19200 bps HDO/DVX bus connection through HDO rack with HDX021 or DVX021 cable. Typical update time 2 min.
- **Remote update:** CATVisor Commander 2.9 or later, IP connection through HDC100. Typical update time 3 min.

LATEST VERSION

Version 1.17, released 17.8.2018 – Enhancements

Compatibility

Compatible with all HDP120, HDP230 and HDP301 hardware versions.

Field upgradeable to all previous software versions.

All required viewer files are included in DUS100 package version 5.9 or later.

New features

- Added support for new fan model. Older software versions can occasionally give false “Fan failure” alarm with some new fan units. (Shout! 24538)
- Internal changes not visible to end-user. (Shout 35489, 35491, 35492)

OLDER VERSIONS

Version 1.15, released 3.12.2013 – Minor bug fixes and enhancements

Compatibility

- Compatible with all HDP230 and HDP301 hardware versions.
- Field upgradeable to all previous software versions.

New features

- Added support for "Notes" field. (Shout! 19001)

Fixes

- Improved HDO rack address detection. (Shout! 22414)
- Internal changes not visible to end-user. (Shout! 22440, 22760, 22366)

Version 1.11, released 12.2.2008 – Minor bug fixes

Fixes

- Fixed empty alias name not shown right.
- Improved uptime calculation accuracy.

Version 1.6, released 8.12.2005 – Minor bug fixes and enhancements

New features

- Added intelligent variable speed temperature based fan control.
- Changed maximum alias name length from 15 to 63 characters.

Fixes

- Fixed bug which caused alarm to not appear if both fans failed simultaneously.
- Fixed bug which caused "Total output power" field background colour to be incorrect in viewer if alarms on total output power were disabled.
- Fixed bug which caused "Settings changed" alarm to not appear correctly.
- Fixed bug in analog value not updating in "Monitoring" viewer page, if parameter value was over / under disabled alarm limit.
- Fixed bug in alarm log, which caused log corruption after reset.

Version 1.2, released 8.8.2005 – Major bug fix

Fixes

- Fixed bug in setting functional parameters (for example alarm limits). This bug caused hangup of the unit and HDO bus in some situations.
- Fixed bug in fan speed measurements and alarms.
- Fixed bug in temperature measurement.

Version 1.0, released 23.6.2005 – First customer version